34823B/18 H01 Q49 BOREHOLE REINFORCE

BORE = 04.01.76

*SU -612-004

04.01.76-SU-308922 (26.05.78) E21b-29
Well tubing patcher with collet - has bush slotted to take rod pin and so reduce axial load during patch placing

The patcher comprises a rod connected to an adapter and piston concentric within a cylinder and also has a thrust sleeve with expander cone fitted to it, and a collet head and collar component. To place the patch accurately and securely, the axial load has to be reduced. This is achieved by slotting the bush lengthways and providing the rod a pin arranged in the slot.


AILS

Once the patch has been positioned over the defect, hole, dent etc. in the tubing, the bottom cylinder is energised so as to raise the collet, held shut by the collar. Once the collet enters the crimped patch sleeve, a pin contacts the collar and strips it off the flexible end of the collet thus enabling this to spread out and in so doing clamp the crimped patching tube securely to the inside of the well tubing. The smoothing action is completed as the collet rises further up inside the patch tube.

Axial load is governed by the stiffness of the path and

H(1-B3C, 1-C1).

remains at a constant level so that the patcher works reliably and accurately, placing the patch in the precise location within the tubing, even at depth and in narrow tubing.

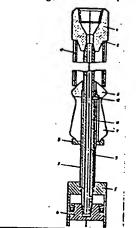

SU-612004

CO103 COROTCKNX Социалистических Республик



feergasersessut commen Bezera Missatres BCEP fereireftein menes en E GTEPHTES

ОПИСАНИЕ изобретения

К АВТОРСКОМУ СВИДЕТЕЛЬСТВУ

(61) Дополнительное к авт. свид-ву -

(22) Заявлено 04.01.76 (21) 2308922/22-03

с присоединением заявки №

(23) Приоритет

(43) Опубликовано 250678. Бюллетень № 23 (53) УДК 622.248.13

(45) Дата опубликования описания 26.05.78

(11) 612004

(51) М. Кл.

E 21 B 29/00

(72) Авторы изобретения

В.В. Еременко, С.В. Виноградов, В.А. Габец, Ф.Ф. Конрад и С.Ф.Петров

(71) Заявитель

Всесоюзный научно-исследовательский институт по креплению скважин и буровым растворам

УСТРОЯСТВО ДЛЯ УСТАНОВКИ МЕТАЛЛИЧЕСКОГО пластыря внутри трубы

Изобретение относится к устройствам, применяемым в нефтяной промышленности при ремонте колонны труб в буровых и эксплуатационных скважинах.

Известно устройство для установки металлического пластыря внутри трубы, содержащее эластичный баллон с жидкостью, расположенный внутри устанавливаемого пластыря, выполненного в виде гофрированного патрубка [1].

Недостатком этого устройства является невозможность обеспечения равномерного расширения гофрированного патрубка по его длине.

Наиболее близким решением к предлагаемому изобретению является устрояство для установки металлического пластыря внутри трубы, включающее шток, соединенный с переводником и поршнем, концентрично размещенным в цилиндре, распорную втулку, на которой установлены расширяющий конус, цанговая головка и обояма [2].

Непостатком устройства является низкая надежность работы, так как при вхождении в гофрированный патрубок расширяющейся многосекторной головки многократно увеличивается осевая нагрузка на трубы, протягивающие головку, через патрубок.

Цель изобретения - повышение надежности работы устройства за счет снижения осевых нагрузок.

Это достигается тем, что распорная втулка выполнена с продольной прорезью, а шток с выступом, размещенным в прорези втулки.

На чертеже изображено устройство для установки металлического пластыря внутри трубы, продольный разрез.

устройство имеет переводник 1 с упорным буртом 2, шток 3 с поршнем 4, взаимодействующим с подвижным цилиндром 5, жесткого конуса 6, выполненного за одно целое с многосекторноя упругорасширяющейся цанговой головкой 7, зафиксированной при транспортировании в сжатом состоянии цилиндрической обоймой 8, установленной с возможностью осевого перемещения на распорной втулке 9, расположенной между цилиндром и жестким конусом. Гофрированный патрубок 10, являющийся заготовкой металлического пластыря, расположен при спуске в скважину между упорным буртом 2 и жестким конусом б. В распорной втулке 9 имеется продоль-

ное окно 11, через которое выступает наружу штырь 12, жестко закрепленный на штоке.

30

15

ого пластыря внутри трубы работа
с. следующим образом. Устройство с
гофрированным патрубком 10 спускают в
скважину так, чтобы середина гофрированного патрубка совпала с серединой
дефекта в колонне труб. Затем насосом
создают рабочее давление в цилиндре
5. При рабочем давление в цилиндре
5. При рабочем давлении цилиндр перемещается в сторону гофрированного патрубка, толкая перед собой жесткия конус 6 и цанговую головку 7, сжатую
обоймой 8.

При этом цилиндрическая обояма 8 и штырь 12 сближаются; расстояние между ними в исходном положении равно расстоянию от торца гофрированного патрубка 10 до наибольшего поперечника цанговой головки 7. Как только цанговая головка заходит в гофрированный патрубок до своего наибольшего поперечника, штырь 12 входит в контакт с цилиндрической обоймой 8 и снимает ее с упругого конца цанговой головки. Цанговая головка упруго: расширяется, расправляет гофрированный патрубок до круглого сечения, прижимая его к внутреннея поверхности ремонтируемой трубы. При дальнейшем движении жесткого конуса и цанговой головки внутри гофрированного патрубка, последния ~прямлиется и равномерно на всей

зя длине прижимается к ремонтируетрубе, При этом осевая нагрузка на устройство определяется в основном жесткостью гофрированного патрубка


и остается примерно постоянной. Благодаря снижению осевых нагрузок на устройство, повышается надежность его работы и оно может успешно применяться для установки пластырей в скваживах большей глубины и в трубах меньшего диаметра, что существенно расширяет область применения устройства этого назначения и обеспечит получение высокого технико-экономического

Формула изобретения

Устройство для установки металлического пластыря внутри трубы, включающее шток, соединенный с переводником и поршнем, концентрично размещенным в цилиндре, распорную втулку, на которой установлены расширяющий конус, цанговая головка и обойма, о т л и чаю щеес с я тем, что, с целью повышения надежности работы устройства за счет снижения осевых нагрузок, распорная втулка выполнена с продольной прорезью, а шток — с выступом, размещенным в прорези втулки.

Источники информации, принятые во внимание при экспертизе:

- 1. Сидоров И.А. Восстановление герметичности обсадных колонн в нефтяных и газовых скважинах. Серия ''Бурение'' Внииоэнг, М., 1972, с. 56.
- 2. Патент США № 3179169, кл. 166-14, 1965.

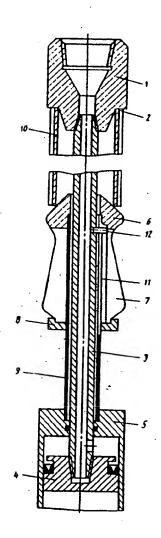

Редактор. Л.Лашкова

Составитель В.Борискина Техред З. Фанта Ко

Корректор М. Демчик.

Закаэ 3421/30 Тираж 734 Подписное ЦНИИПИ Государственного комитета Соъета Министров СССР по делам изобретения и открытия 113035, Москва, ж-35, Раушская наб., д.4/5

[see English abstract-separate page]

Union of Soviet Socialist Republics	SPECIFICATION OF INVENTOR'S CERTIFICATE	(11) 612004	
[state seal]	(61) Inventor's certificate of addition —		
	(22) Applied January 4, 1976 (21) 2308922/22-03 with the attachment of application No	(51) Int. Cl. ² E 21 B 29/00	
State Committee of the USSR Council of Ministers on Inventions and Discoveries			
	(43) Published June 25, 1978. Bulletin		
	No. 23 (45) Publication date of specification	(53) UDC 622.248.13	
•	May 26, 1978	(088.8)	
(72) Inventors V.	. Eremenko, S. V. Vinogradov, V. A. Gabets, F. F. Konrad, and S. F.		
Pet	= :		
(71) Applicant All	l-Union Scientific-Research Institute of Well Casing and Drilling Muds		

(54) DEVICE FOR PLACING A METAL PATCH INSIDE A PIPE

1

The invention relates to devices used in the oil industry for casing repair in drilled and development wells.

A device is known for placing a metal patch inside a pipe that contains an elastic inflatable bag with liquid located inside the patch to be placed, implemented in the form of a corrugated sleeve [1].

A disadvantage of this device is that it is impossible to ensure uniform expansion of the corrugated sleeve over its length.

The design closest to the proposed invention is a device for placing a metal patch inside a pipe that includes a rod joined to an adapter and a piston concentrically disposed in a cylinder, a spacer bushing with an expanding cone, a collet head, and a holder mounted thereon [2].

A disadvantage of the device is the low operational reliability, since as the expanding multisector head enters the corrugated sleeve, there is a many-fold increase in the axial load on the pipes pulling the head through the sleeve.

The aim of the invention is to improve the operational reliability of the device by reducing the axial loads.

This is achieved by the fact that the spacer bushing is implemented with a longitudinal slot, while the rod is implemented with a lug disposed in the slot of the bushing.

The drawing depicts the device for placing a metal patch inside a pipe, in longitudinal section.

The device has adapter 1 with thrust shoulder 2, rod 3 with piston 4, engaging movable cylinder 5, rigid cone 6 that is implemented integrally together with multisector, elastically expanding collet head 7, secured in the compressed state during run-in by cylindrical holder 8, mounted so that it can move axially on spacer bushing 9, disposed between the cylinder and the rigid cone. Corrugated sleeve 10, which is a metal patch blank, is disposed between thrust shoulder 2 and rigid cone 6 while being lowered into the well. Spacer bushing 9 has longitudinal port 11 through which pin 12, rigidly attached to the rod, projects out.

The device for placing a metal patch inside a pipe operates as follows. The device with corrugated sleeve 10 is lowered into the well so that the middle of the corrugated sleeve coincides with the middle of the defect in the string. Then the working pressure in cylinder 5 is created by a pump. At the working pressure, the cylinder moves toward the corrugated sleeve, pushing ahead of it rigid cone 6 and collet head 7, compressed by holder 8.

In this case, cylindrical holder 8 and pin 12 approach each other; the distance between them in the initial position is equal to the distance from the end of corrugated sleeve 10 to the largest cross section of collet head 7. As soon as the collet head enters the corrugated sleeve up to its largest cross section, pin 12 makes contact with cylindrical holder 8 and detaches it from the elastic end of the collet head. The collet head is elastically expanded, straightens out the corrugated sleeve to a circular cross section, squeezing it against the inside surface of the pipe to be repaired. As the rigid cone and the collet head move further inside the corrugated sleeve, the latter is straightened out and is squeezed against the pipe to be repaired uniformly over its entire length. In this case, the axial load on the device is determined mainly by the rigidity of the corrugated sleeve

4

and remains approximately constant. Because of the reduction in axial loads on the device, its operational reliability is improved and it can be successfully used for placing patches in deep wells and in small-diameter pipes, which substantially extends the range of application for this type of device and provides considerable technical and economic advantages.

Claim

A device for placing a metal patch inside a pipe, including a rod joined to an adapter and a piston concentrically disposed in a cylinder, a spacer bushing with an expanding cone, a collet head, and a holder mounted thereon, *distinguished* by the fact that, with the aim of improving the operational reliability of the device by reducing the axial loads, the spacer bushing is implemented with a longitudinal slot and the rod is implemented with a lug disposed in the slot of the bushing.

Information sources considered in the examination:

- 1. I. A. Sidorov, Repairing Casing Leaks in Oil and Gas Wells. Drilling Series. [in Russian], VNIIOÉNG, Moscow (1972), p. 56.
 - 2. US Patent No. 3179169, cl. 166-14, 1965.

[see Russian original for figure]

Editor L. Lashkova	Compiler V. E Tech. Editor Z. Fanta	Proofreader M. Demchik		
Order 3421/30	Run 734	Subscription edition		
Central Scientific Research Institute of Patent Information and Technical and Economic Research of the State Committee of the USSR Council of Ministers on Inventions and Discoveries [TsNIIPI] 4/5 Raushskaya nab., Zh-35, Moscow 113035				
Branch of "Patent" Printing Production Plant, 4 ul. Proektnaya, Uzhgorod				

AFFIDAVIT OF ACCURACY

I, Kim Stewart, hereby certify that the following is, to the best of my knowledge and belief, true and accurate translations performed by professional translators of the following patents from Russian to English:

RU2016345 C1 RU2039214 C1 RU2056201 C1 RU2064357 C1 RU2068940 C1 ATLANTA RU2068943 C1 BOSTON RU2079633 C1 BRUSSELS RU2083798 C1 CHICAGO RU2091655 C1 RU2095179 C1 DETROIT RU2105128 C1 FRANKFURT RU2108445 C1 NOTZUCH RU21444128 C1 LONDON SU1041671 A LOS ANGELES SU1051222 A MIAMI SU1086118 A MINNEAPOLIS SU1158400 A NEW YORK SU1212575 A PARIS SU1250637 A1 PHILADELPHIA SU1295799 A1 SAN DIEGO SAN FRANCISCO SU1411434 A1 SEATTLE SU1430498 A1 WASHINGTON, DC SU1432190 A1 SU 1601330 A1 SU 001627663 A SU 1659621 A1 . SU 1663179 A2 SU 1663180 A1 SU 1677225 A1 SU 1677248 A1 SU 1686123 A1 SU 001710694 A SU 001745873 A1 SU 001810482 A1 SU 001818459 A1 350833 SU 607950 SU 612004 620582 641070 853089 832049 WO 95/03476

Page 2 **TransPerfect Translations** Affidavit Of Accuracy Russian to English Patent Translations

Kim Stewart

TransPerfect Translations, Inc. 3600 One Houston Center

1221 McKinney Houston, TX 77010

Sworn to before me this 23rd day of January 2002.

Signature, Notary Public

OFFICIAL SEAL MARIA A. SERNA NOTARY PUBLIC In and for the State of Texas My commission expires 03-22-2003

Stamp, Notary Public

Harris County

Houston, TX

This Page is Inserted by IFW Indexing and Scanning Operations and is not part of the Official Record

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

BLACK BORDERS

IMAGE CUT OFF AT TOP, BOTTOM OR SIDES

FADED TEXT OR DRAWING

BLURRED OR ILLEGIBLE TEXT OR DRAWING

SKEWED/SLANTED IMAGES

COLOR OR BLACK AND WHITE PHOTOGRAPHS

GRAY SCALE DOCUMENTS

LINES OR MARKS ON ORIGINAL DOCUMENT

REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY

IMAGES ARE BEST AVAILABLE COPY.

OTHER:

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.